

Put 10 mm Vee dop in and lock collet down. Put index plate on 96. Lower hand piece to 90 degrees. Remove splash pan and any laps on the machine, exposing brass platen. Slowly lower mast until one corner of the vee dops rests on the platen. Adjust cheater until vee is flat on the platen. This is you new zero point.

